



Technical Service Bulletin

No. JTB00007v5
10 March 2009

Reissue

Please replace the previous edition of this bulletin.

This bulletin supersedes TSB JTB00007v4/2008 dated 01 July, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page).

Subject/Concern: Dynamic Stability Control (DSC) Lamp Illuminated After Cranking

Models:

X-TYPE	Gasoline - FWD and AWD Automatic Only	Gasoline - FWD and AWD Automatic Only VIN-range: D55322-J12992
--------	---------------------------------------	--

Markets: All

Section: 206-09

Summary:

After cranking, the DSC lamp illuminates and remains 'ON' for the remainder of the ignition cycle, with the possibility of Diagnostic Trouble Code (DTC) U1900 stored.

NOTE: The DSC will not function whilst the light is illuminated.

This version has been issued to inform Authorized Repairers that the Anti-lock Brake System (ABS) module is now available as a serviceable part. It is no longer necessary to replace the complete Dynamic Stability Control Module (DSCM).

Cause: Missing Controller Area Network (CAN) message. **Suggested Customer Concern Code - H19.**

Action: Should a customer express concern, install a new ABS module. Refer to Global Technical Reference GTR Workshop Manual, section: 206-09 (70.60.02).

Parts Required:

Description	Part Number	Quantity
ABS module - 2.0L	C2S 51210	1
ABS module - 2.5L and 3.0L	C2S 51209	1

Labour Time:

Operation Description	Operation No.	Time
Install a new ABS module	70.60.02	0.4 hours

Repair/Claim Coding:

Causal Part:	2.0L - C2S 51210 / 2.5L and 3.0L - C2S 51209
ACES Condition Code:	42
Defect Code:	

© 2009 Jaguar