



Technical Service Bulletin

No.A206-07
04 April 2005

Subject/Concern:	Creak/Chirp Noise Emanating from the Rear of the Vehicle Over Rough/Uneven Surfaces
-------------------------	---

Models:		
X-TYPE		VIN-range: C00294-E45113

Markets: All

Section: 206-05

Summary:
This Technical Bulletin has been issued to address customer concerns of a creak/chirp noise emanating from the rear of the vehicle over rough/uneven surfaces.
Cause: The parking brake cables being over-size causing a creak/chirp from the rear of the vehicle.
Action: Should a customer express concern, and it has been confirmed the creak/chirp is emanating from the parking brake cable, measure the parking brake cable diameter. If 12.5mm or above, replace the cables. This is to be carried out as a separate Warranty Claim. If the parking brake cable is under 12.5mm, install new modified parking brake cable C-clips. Follow the Service Instruction outlined below.

Parts Required:		
Description	Part Number	Quantity
Parking brake cable C-clip	C2S 41307	2


NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

Labour Time:		
Operation Description	Operation No.	Time
Install parking brake cable C-clips	10 10 99	0.2 hours


Repair/Claim Coding:	
Causal Part:	C2S 41307
ACES Condition Code:	N/A
Defect Code:	N/A

Service Instruction


- 1 . Raise vehicle on ramp.
- 2 . Detach the rear parking brake cable from the mounting.

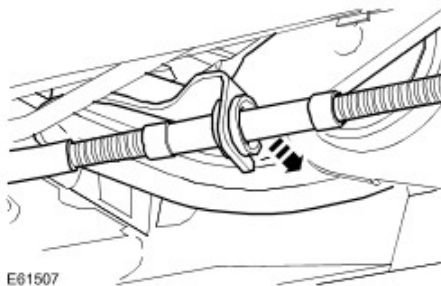


- 3 . Detach the C-clip from the rear parking brake cable.

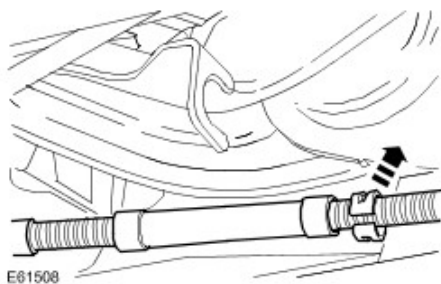

- 4 . Install the new C-clip to the rear parking brake cable.

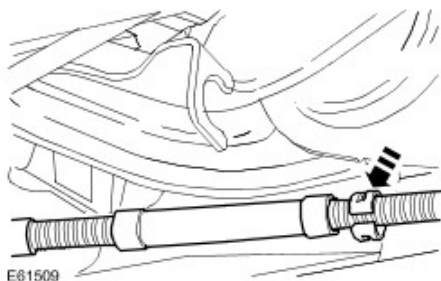

- 5 . Install the rear parking brake cable to the mounting, ensuring the C-clip is in the centre of the crimps.

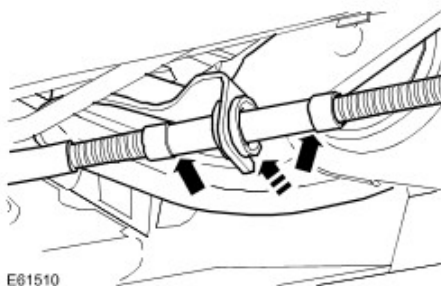

- 6 . Carry out steps 2 to 5 for the opposite side rear parking brake cable.
7 . Lower the ramp.

© 2005 Jaguar