



Technical Service Bulletin

No.JTB00009v2
07 October 2008

This bulletin supersedes TSB JTB00009/2006 dated 28 November, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page).

Subject/Concern:	Brakes Holding On
-------------------------	-------------------

Models:		
X-TYPE	Diesel Only	Diesel Only VIN-range: E51196-J12292

Markets: All

Section: 206-07

Summary:
The brake pedal does not return to the original position after braking to a standstill.
This version has been issued for a change in Parts Required and to add a CCC.
Cause: Fault with the internal spring within the brake booster. Suggested Customer Concern Code - H20.
NOTE: Any fault that is not described in the Summary must be carried out as a separate Warranty Claim.
Action: Should a customer express concern, detach the brake booster vacuum hose and see if the brake pedal returns to its original position. If the brake pedal returns to its original position, install a new brake booster. The parts now available from Unipart have been re-tested and are to an assured condition. Follow the Service Instruction outlined below.

Parts Required:		
Description	Part Number	Quantity
Brake booster Left-hand drive	C2S 31057	1
Brake booster Right-hand drive	C2S 31058	1
O-ring seal	C2S 16178	1

Labour Time:		
Operation Description	Operation No.	Time
Brake booster - Renew - Left-hand drive	70.50.17	0.7 hours
Brake booster - Renew - Right-hand drive	70.50.17	0.8 hours

Repair/Claim Coding:	
Causal Part:	C2S 31057
ACES Condition Code:	42
Defect Code:	

Service Instruction

1. Brake booster - Renew (see Global Technical Reference GTR Workshop Manual, section: 206-07 (70.50.17)).

©2008 Jaguar