



Technical Service Bulletin

No.A308-10
20 April 2004

Subject/Concern:	Clutch Pedal Squeak
-------------------------	---------------------

Models:		
X-TYPE	2.2L Diesel Only	2.2L Diesel Only VIN-range: E73994-E99675

Markets: All

Section: 308-02


Summary:
This bulletin addresses customer concerns of a squeaking/creaking noise from the clutch pedal when operating.
Cause: Foul condition between the clutch pedal retaining clip and lower spring retainer.
Action: Should a customer express concern, correct the alignment of the clutch pedal retaining clip. Follow the Service Instruction outlined below.

Labour Time:		
Operation Description	Operation No.	Time
Correct the alignment of the retaining clip	33.91.04	0.2 hours

Repair/Claim Coding:	
Causal Part:	C2S 41437 RHD - C2S 41446 LHD
ACES Condition Code:	N/A
Defect Code:	

Service Instruction

- 1 . Open driver door.
- 2 . Inspect clutch pedal retaining clip against illustration E80255 to confirm foul condition.

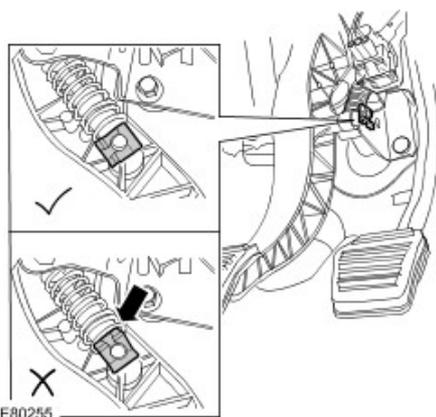

- 3 . Rotate the clutch pedal retaining clip through 90 degrees so the foul condition is removed (see illustration E80255).
- 4 . Close driver door.

©2004 Jaguar