



Technical Service Bulletin

No.JTB00077v2
11 July 2008

Reissue

Please replace the previous edition of this bulletin.

This bulletin supersedes TSB JTB00077/2008 dated 14 January, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page).

This bulletin supersedes TSB JTB00048/2007 dated 19 June, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page).

Subject/Concern:	'Moan' Noise from Rear Brakes When Reversing or Manoeuvring Slowly
-------------------------	--------------------------------------------------------------------

Models:

X-TYPE	Two wheel drive.	Two wheel drive. VIN-range: E24054-J28416
X-TYPE	All-wheel drive (North America).	All-wheel drive (North America). VIN-range: E24054-J35344
X-TYPE	All-wheel drive (Rest Of The World).	All-wheel drive (Rest Of The World). VIN-range: E24054-J39172

Markets: All

Section: 206-04

Summary:

This bulletin addresses customer concerns of a 'moan' noise emanating from the rear brakes when reversing or Manoeuvring slowly.

This Version has been issued due to a change in the Model section and Causal Part Number.

Cause: Inner brake pads dragging. **Suggested Customer Concern Code - N17.**

Action: Should a customer express concern, install new rear suspension modified rear knuckle front bushings. Follow the Service Instruction outlined below.

Parts Required:

Description	Part Number	Quantity
Rear knuckle front bushing	C2S 46380	2

Labour Time:

Operation Description	Operation No.	Time
Rear knuckle front bushing - Vehicle set - Renew - Front wheel drive	64.15.29	2.5 hours
Rear knuckle front bushing - Vehicle set - Renew - All-wheel drive	64.15.29	3.3 hours


Repair/Claim Coding:

Causal Part:	C2S46380
ACES Condition Code:	63
Defect Code:	

Service Instruction

- Remove rear knuckle front bushing (see Global Technical Reference GTR Workshop Manual, section: 204-02 - Rear Suspension - Wheel Knuckle Front Bushing (64.15.28)).
- NOTE:** The new bushing are voided, and the voids need to be in the correct orientation when installed (see E85332).

Install the new rear knuckle front bushing (see Global Technical Reference GTR Workshop Manual, section: 204-02 - Rear Suspension - Wheel Knuckle Front Bushing (64.15.28)).

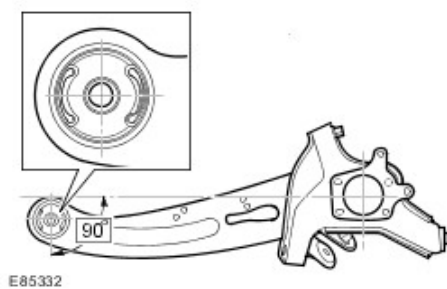

3 . Carry out steps 1 and 2 to the opposite side of the vehicle.

© 2008 Jaguar